

KLEEN INSPECTION

SAFE TO BUY YOUR HOME (310-722-0396)



Inspection Report

Mr. Mauricio Zavala

Property Address:
1414 West 137th Street
Compton CA 90222



Kleen Inspections

David A. Glover
335 E. Albertoni St. 200/217
Carson, CA. 90746
310-722-0396



Table of Contents

[Cover Page..... 0](#)

[Table of Contents..... 0](#)

[Intro Page 0](#)

[1 Roofing..... 5](#)

[2 Exterior..... 7](#)

[3 Garage..... 18](#)

[4 Interiors 20](#)

[5 Structural Components 25](#)

[6 Plumbing System 28](#)

[7 Electrical System 30](#)

[8 Heating / Central Air Conditioning34](#)

[9 Insulation and Ventilation..... 35](#)

[10 Built-In Kitchen Appliances 36](#)

[General Summary..... 0](#)

[Agreement 0](#)

Date: 3/21/2013	Time: 10:00 AM	Report ID: 032013
Property: 1414 West 137th Street Compton CA 90222	Customer: Mr. Mauricio Zavala	Real Estate Professional: Oracio Carrillo ReMax VIP

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

Standards of Practice:

INACHI National Association of Certified
Home Inspectors

In Attendance:

Customer

Type of building:

Single Family (1 story)

Approximate age of building:

Over 25 Years

Temperature:

Below 65 (F) = 18 (C)

Weather:

Clear

Ground/Soil surface condition:

Dry

Rain in last 3 days:

No

Radon Test:

No

Water Test:

No

1. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

		IN	NI	NP	RR	Styles & Materials
1.0	Roof Coverings	•				Roof Covering: Asphalt/Fiberglass
1.1	Flashings	•			•	Viewed roof covering from: Walked roof
1.2	Skylights, Chimneys and Roof Penetrations	•				Sky Light(s): None
1.3	Roof Drainage Systems			•		Chimney (exterior): N/A


IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

1.1 Inspector found flashing raised instead of being flat; which can have a potential for water intrusion. Inspector found no leaks in the home to state that the flashing is allowing water to penetrate.



1.1 Picture 1

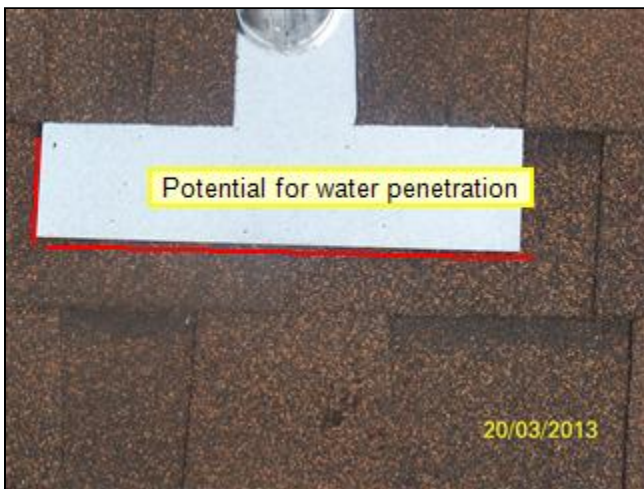

1.1 Picture 2

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

2. Exterior



The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

		IN	NI	NP	RR	Styles & Materials
2.0	Wall Cladding Flashing and Trim	•				Siding Style: Cement stucco
2.1	Doors (Exterior)	•				Siding Material: EIFS
2.2	Windows	•				Exterior Entry Doors: Wood
2.3	Decks, Balconies, Stoops, Steps, Areaways, Porches, Patio/Cover and Applicable Railings	•				Appurtenance: Sidewalk
2.4	Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)	•			•	Driveway: Concrete
2.5	Eaves, Soffits and Fascias	•			•	
2.6	Additional Buildings on Property	•			•	

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

Comments:

2.4 Inspector found a crack in the retaining wall. Please have a licensed contractor investigate an repair if needed. Inspector found two large holes in the rear yard. This can be a potential risk to individual walking near and fall into hole. Please have holes sealed with concrete, in order to prevent any incidents from happening.



2.4 Picture 1



2.4 Picture 2



2.4 Picture 3

2.5 (1) Inspector found the exterior fascia boards having dry rot, and water stains from the roof previously leaking. Also beehives were found, please have a licensed contractor



2.5 Picture 1



2.5 Picture 2



2.5 Picture 3



2.5 Picture 4



2.5 Picture 5



2.5 Picture 6

(2) Inspector found the garage rear fascia boards dry rotted, due to water damage. Please make sure termite inspector check for wood destroying pest. Please have a licensed contractor repair all areas of concern.



2.5 Picture 7

2.6 Inspector found an addition to dwelling, please have City of Compton come out and perform their mandatory pre-inspection, at this that time all issues with dwelling will be exposed and asked to be permitted or removed.



2.6 Picture 1



2.6 Picture 2



2.6 Picture 3



2.6 Picture 4

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. Garage

		IN	NI	NP	RR	Styles & Materials
3.0	Garage Ceilings	•				Garage Door Type: One manual Garage Door Material: Metal Auto-opener Manufacturer: N/A
3.1	Garage Walls (including Firewall Separation)	•				
3.2	Garage Floor	•				
3.3	Garage Door (s)	•			•	
3.4	Occupant Door (from garage to inside of home)			•		
3.5	Garage Door Operators (Report whether or not doors will reverse when met with resistance)	•				

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

Comments:

3.3 The garage door was built to low which prevents the rear exterior door from opening and closing. Please modify garage door, so that rear side door can function properly.



3.3 Picture 1

3.5 The garage door is manual

4. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

		IN	NI	NP	RR	Styles & Materials
4.0	Ceilings	•				Ceiling Materials: Plaster
4.1	Walls	•				Wall Material: Plaster
4.2	Floors	•				Floor Covering(s): Carpet Hardwood T&G Tile
4.3	Steps, Stairways, Balconies and Railings			•		
4.4	Counters and Cabinets (representative number)	•				Interior Doors: Hollow core
4.5	Doors (representative number)	•			•	Window Types: Thermal/Insulated
4.6	Windows (representative number)	•			•	Window Manufacturer: UNKNOWN
						Cabinetry: Wood
						Countertop: Granite

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

4.5 Sliding glass and interior bedroom door have no door handles. Please have a licensed contractor repair all areas of concern.



4.5 Picture 1



4.5 Picture 2



4.5 Picture 3

4.6 Inspector found no insect screen in bedroom window. Please have a screen installed to keep out flying pest.



4.6 Picture 1

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

5. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

		IN	NI	NP	RR	Styles & Materials
5.0	Foundations, Basement and Crawlspace (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	•				Foundation: Masonry block Method used to observe
5.1	Walls (Structural)	•				Crawlspace: Limited access
5.2	Columns or Piers	•				Floor Structure: Wood joists
5.3	Floors (Structural)	•				Wall Structure: Masonry
5.4	Ceilings (Structural)	•				Columns or Piers: Wood piers Masonry block
5.5	Roof Structure and Attic	•			•	Ceiling Structure: 2X4 Roof Structure: 2 X 4 Rafters Roof-Type: Gable Flat Method used to observe attic: Walked Attic info: Attic access

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

5.5 (1) Inspector found a loose board in the attic, please have a licensed contractor secure boards to attic foundation.



5.5 Picture 1

(2) Inspector found exposed roofing underlayment exposed in the garage. Please have licensed roofing contractor investigate and repair as needed.



5.5 Picture 2



5.5 Picture 3

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

6. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

		IN	NI	NP	RR	Styles & Materials
6.0	Plumbing Drain, Waste and Vent Systems	•				Water Source: Public
6.1	Plumbing Water Supply, Distribution System and Fixtures	•			•	Water Filters: None
6.2	Hot Water Systems, Controls, Chimneys, Flues and Vents	•				Plumbing Water Supply (into home): Copper
6.3	Main Water Shut-off Device (Describe location)	•				Plumbing Water Distribution (inside home): PVC
6.4	Fuel Storage and Distribution Systems (Interior fuel storage, piping, venting, supports, leaks)	•				Washer Drain Size: 2" Diameter
6.5	Main Fuel Shut-off (Describe Location)	•				Plumbing Waste: PVC
6.6	Sump Pump			•		Water Heater Power Source: Gas (quick recovery) Water Heater Capacity: 40 Gallon (1-2 people) Manufacturer: UNKNOWN Water Heater Location: Main Floor

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

6.1 Inspector found front hose bibb shut-off valve not working. Please have a licensed plumber correct ball valve to function properly.



6.1 Picture 1

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

7. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

		IN	NI	NP	RR	Styles & Materials
7.0	Service Entrance Conductors	•				Electrical Service Conductors: Overhead service Panel capacity: 100 AMP Panel Type: Circuit breakers Electric Panel Manufacturer: GENERAL SWITCH Unknown Branch wire 15 and 20 AMP: Copper Wiring Methods: Romex
7.1	Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels	•			•	
7.2	Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage	•				
7.3	Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)	•				
7.4	Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, all receptacles in garage, carport and exterior walls of inspected structure	•				
7.5	Operation of GFCI (Ground Fault Circuit Interrupters)	•				
7.6	Location of Main and Distribution Panels	•				
7.7	Smoke Detectors	•				
7.8	Carbon Monoxide Detectors	•				

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

IN NI NP RR

Comments:

7.1 (1) Inspector found panel box open with wiring exposed, please close to prevent electrical shock. The weatherhead too low, and live wires lying on the roof. Please have a licensed electrical contractor investigate, and repair wiring system so that it will function properly and be safe.



7.1 Picture 1



7.1 Picture 2



7.1 Picture 3



7.1 Picture 4

(2) Inspector found new panel box, and weather head installed. Please make sure new electrical, during pre-inspection was permitted by City.



7.1 Picture 5



7.1 Picture 6

7.8 There were no carbon monoxide detector found in the dwelling. Please have a licensed electrician install detector.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

8. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

		IN	NI	NP	RR	Styles & Materials
8.0	Heating Equipment	•				Heat Type: Heat Pump Forced Air (also provides cool air)
8.1	Normal Operating Controls	•				Energy Source: Gas
8.2	Automatic Safety Controls	•				Number of Heat Systems (excluding wood): One
8.3	Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	•				Heat System Brand: UNKNOWN
8.4	Presence of Installed Heat Source in Each Room	•				Ductwork: Non-insulated
8.5	Chimneys, Flues and Vents (for fireplaces, gas water heaters or heat systems)			•		Filter Type: N/A
8.6	Solid Fuel Heating Devices (Fireplaces, Woodstove)			•		Filter Size: N/A
8.7	Gas/LP Firelogs and Fireplaces			•		Types of Fireplaces: None
8.8	Cooling and Air Handler Equipment			•		Operable Fireplaces: None
8.9	Normal Operating Controls			•		Number of Woodstoves: None
8.10	Presence of Installed Cooling Source in Each Room			•		

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

8.4 Inspector found that the one sided heating source may not carry enough BTU's to heat the entire dwelling. Please have a Hvac technician certify that the unit can furnish enough heat to warm each bedroom.

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

		IN	NI	NP	RR	Styles & Materials
9.0	Insulation in Attic	•				Attic Insulation: Blown
9.1	Insulation Under Floor System			•		Ventilation: Gable vents
9.2	Vapor Retarders (in Crawlspace or basement)			•		Exhaust Fans: Fan with light
9.3	Ventilation of Attic and Foundation Areas	•				Dryer Power Source: None
9.4	Venting Systems (Kitchens, Baths and Laundry)	•				Dryer Vent: None
9.5	Ventilation Fans and Thermostatic Controls in Attic	•				Floor System Insulation: NONE

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

		IN	NI	NP	RR	Styles & Materials
10.0	Dishwasher			•		Dishwasher Brand: NONE
10.1	Ranges/Ovens/Cooktops			•		Disposer Brand: UNKNOWN
10.2	Range Hood (s)	•				Exhaust/Range hood: UNKNOWN BRAND
10.3	Trash Compactor			•		Range/Oven: NONE
10.4	Food Waste Disposer	•				Built in Microwave: NONE
10.5	Microwave Cooking Equipment			•		Trash Compactors: NONE

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace

Comments:

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

General Summary



Kleen Inspections

**335 E. Albertoni St. 200/217
Carson, CA. 90746
310-722-0396**

Customer

Mr. Mauricio Zavala

Address

1414 West 137th Street
Compton CA 90222

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roofing

1.1 Flashings


Inspected, Repair or Replace

Inspector found flashing raised instead of being flat; which can have a potential for water intrusion. Inspector found no leaks in the home to state that the flashing is allowing water to penetrate.

1. Roofing



1.1 Picture 1

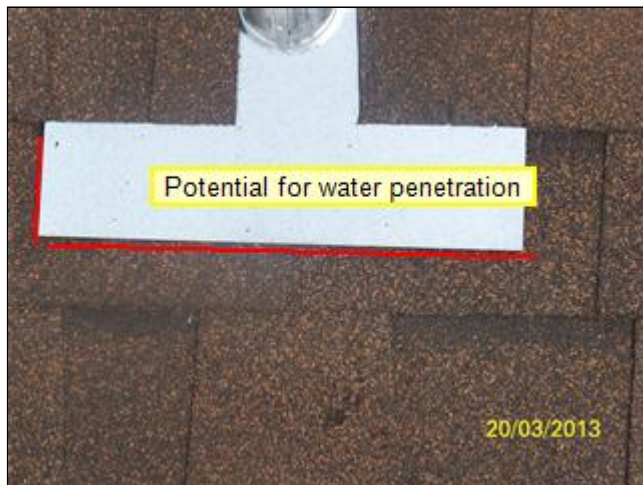

1.1 Picture 2

2. Exterior



2.4 Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)

Inspected, Repair or Replace

Inspector found a crack in the retaining wall. Please have a licensed contractor investigate an repair if needed. Inspector found two large holes in the rear yard. This can be a potential risk to individual walking near and fall into hole. Please have holes sealed with concrete, in order to prevent any incidents from happening.



2.4 Picture 1



2.4 Picture 2



2.4 Picture 3

2.5 Eaves, Soffits and Fascias

Inspected, Repair or Replace

(1) Inspector found the exterior fascia boards having dry rot, and water stains from the roof previously leaking. Also beehives were found, please have a licensed contractor



2.5 Picture 1



2.5 Picture 2



2.5 Picture 3



2.5 Picture 4



2.5 Picture 5



2.5 Picture 6

2. Exterior



(2) Inspector found the garage rear fascia boards dry rotted, due to water damage. Please make sure termite inspector check for wood destroying pest. Please have a licensed contractor repair all areas of concern.



2.5 Picture 7

2.6 Additional Buildings on Property

Inspected, Repair or Replace

Inspector found an addition to dwelling, please have City of Compton come out and perform their mandatory pre-inspection, at this that time all issues with dwelling will be exposed and asked to be permitted or removed.

2. Exterior



2.6 Picture 1



2.6 Picture 2



2.6 Picture 3

2. Exterior



2.6 Picture 4


3. Garage

3.3 Garage Door (s)

Inspected, Repair or Replace

The garage door was built too low which prevents the rear exterior door from opening and closing. Please modify garage door, so that rear side door can function properly.

3. Garage

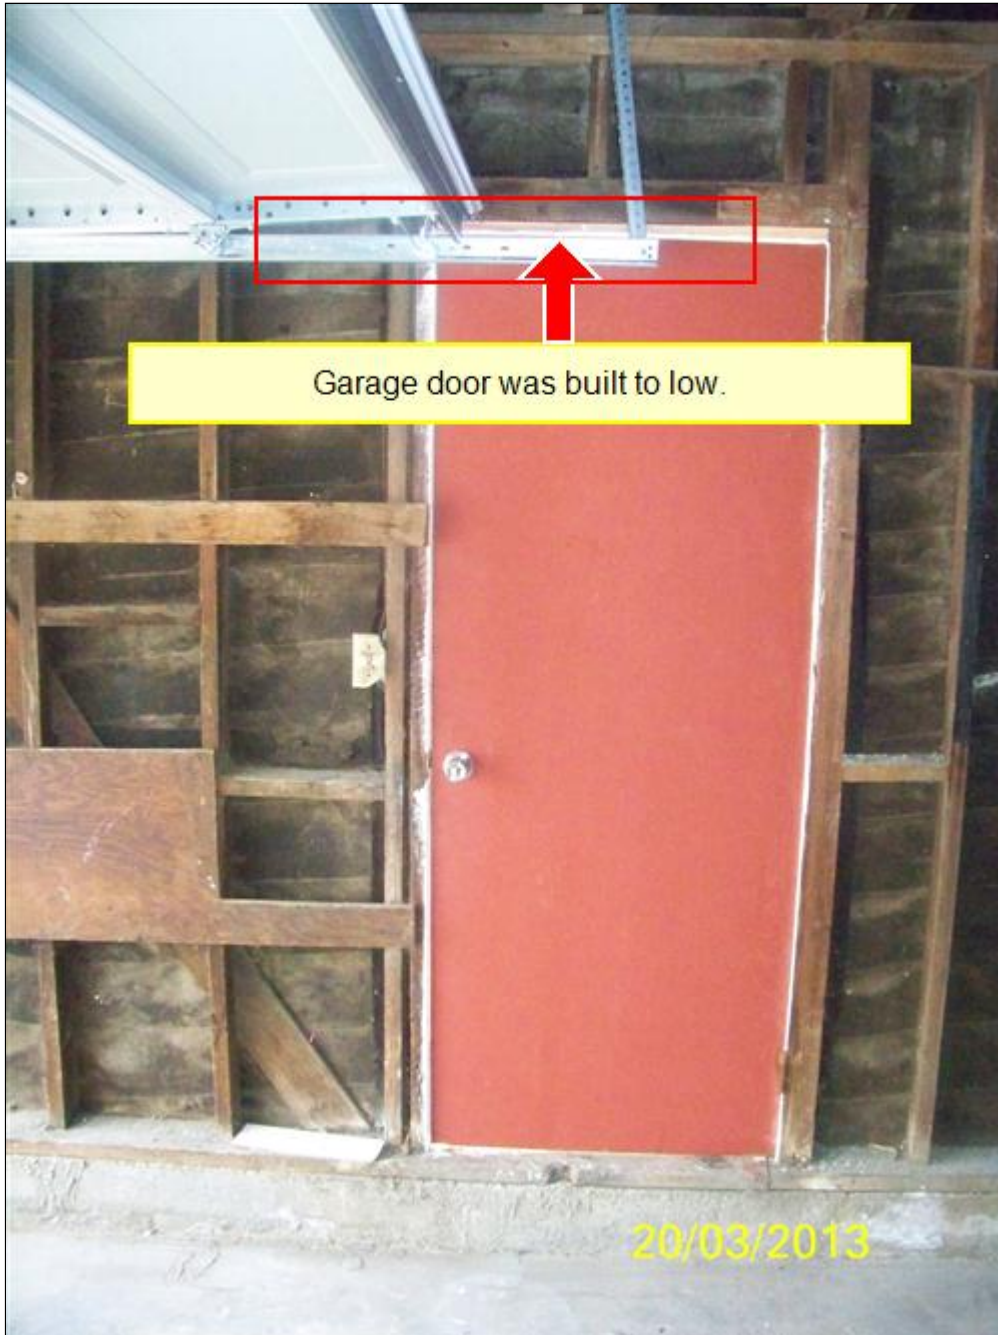

3.3 Picture 1

4. Interiors

4.5 Doors (representative number)

Inspected, Repair or Replace

Sliding glass and interior bedroom door have no door handles. Please have a licensed contractor repair all areas of concern.

4. Interiors




4.5 Picture 1



4.5 Picture 2

4. Interiors

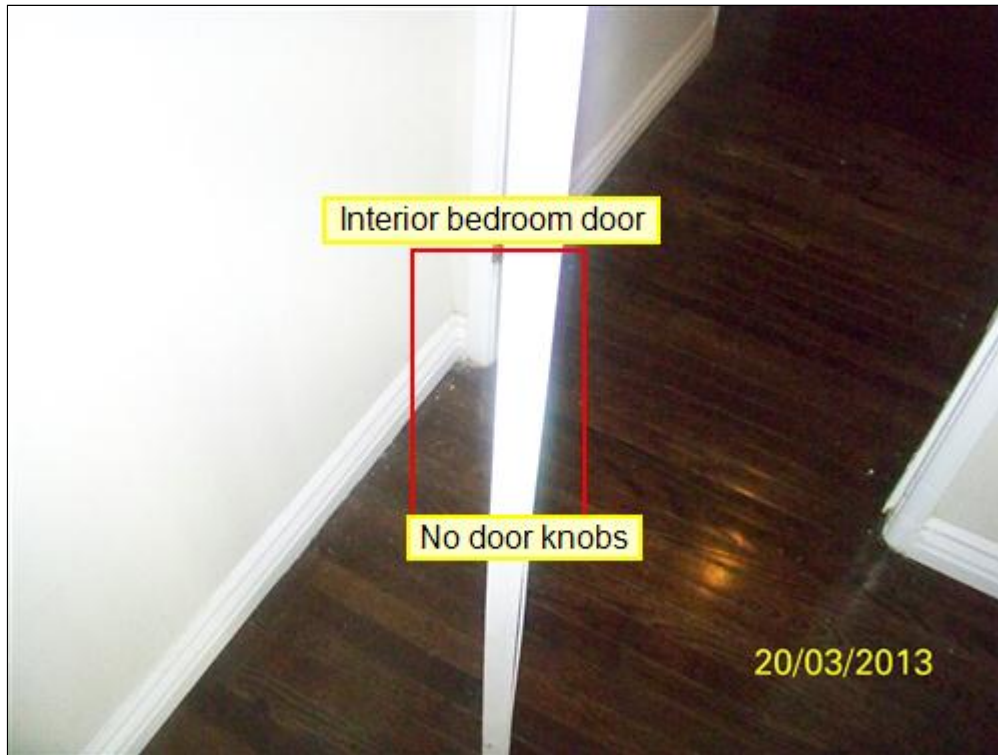


4.5 Picture 3

4.6 Windows (representative number)

Inspected, Repair or Replace

Inspector found no insect screen in bedroom window. Please have a screen installed to keep out flying pest.

4. Interiors

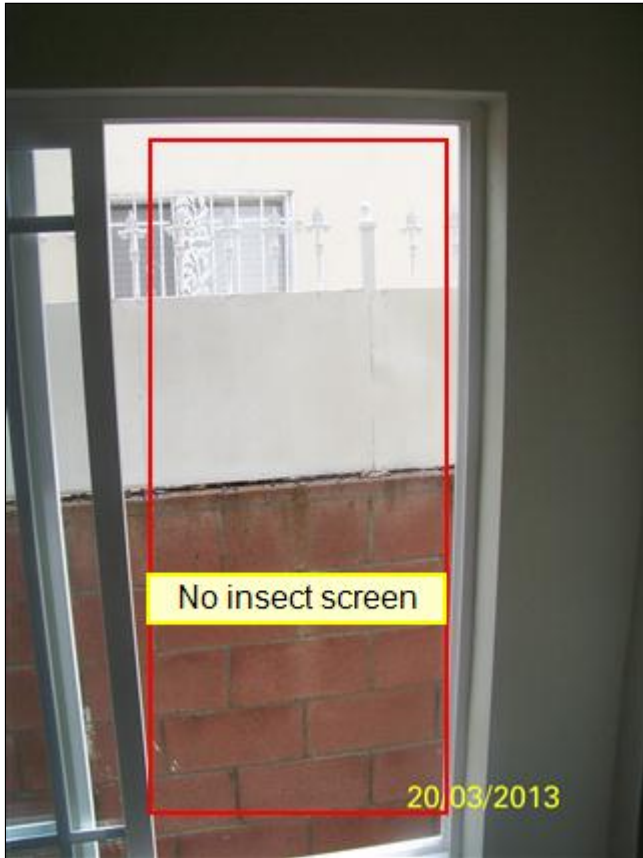

4.6 Picture 1

5. Structural Components

5.5 Roof Structure and Attic

Inspected, Repair or Replace

(1) Inspector found a loose board in the attic, please have a licensed contractor secure boards to attic foundation.

5. Structural Components



5.5 Picture 1

(2) Inspector found exposed roofing underlayment exposed in the garage. Please have licensed roofing contractor investigate and repair as needed.

5. Structural Components



5.5 Picture 2



5.5 Picture 3

6. Plumbing System

6.1 Plumbing Water Supply, Distribution System and Fixtures

Inspected, Repair or Replace

Inspector found front hose bibb shut-off valve not working. Please have a licensed plumber correct ball valve to function properly.

6. Plumbing System



6.1 Picture 1

7. Electrical System

7.1 Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Inspected, Repair or Replace

(1) Inspector found panel box open with wiring exposed, please close to prevent electrical shock. The weatherhead too low, and live wires lying on the roof. Please have a licensed electrical contractor investigate, and repair wiring system so that it will function properly and be safe.

7. Electrical System



7.1 Picture 1



7.1 Picture 2

7. Electrical System



7.1 Picture 3



7.1 Picture 4

(2) Inspector found new panel box, and weather head installed. Please make sure new electrical, during pre-inspection was permitted by City.

7. Electrical System



7.1 Picture 5



7.1 Picture 6

7.8 Carbon Monoxide Detectors

Inspected

There were no carbon monoxide detector found in the dwelling. Please have a licensed electrician install detector.

8. Heating / Central Air Conditioning

8.4 Presence of Installed Heat Source in Each Room

Inspected

Inspector found that the one sided heating source may not carry enough BTU's to heat the entire dwelling. Please have a Hvac technician certify that the unit can furnish enough heat to warm each bedroom.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To David A. Glover

Inspection Agreement

This inspection was performed in accordance with and under the terms of a Pre-Inspection Agreement. The agreement was signed and agreed upon before the preparation of this report and a signed copy of the agreement is available upon request. An unsigned copy of the agreement may be attached to this report for your information or it may also be available on the home inspection company web site.